


Arborist Group
3080 Yonge St Suite 6060,
Toronto, ON M4N 3N1
arboristgroup.com | (647) 479-8778

ADDRESS OF PROPERTY:
2463/2469 Mimosa Row, Mississauga


CLIENT: Majestic Maple

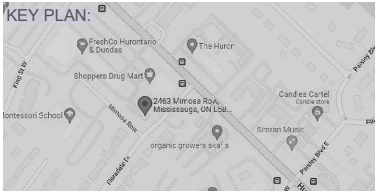

LEGEND

- TREES TO REMAIN TREE PROTECTION ZONE (TPZ)
- TREES TO BE REMOVED
- TREES TO BE INJURED
- SNOW FENCE HOARDING
- PLYWOOD FENCE HOARDING
- HORIZONTAL TREE PROTECTION
- ROOTS SENSITIVE EXCAVATION (R.S.E.)
- TREE REPLANTING LOCATION
- PRIMARY ACCESS ROUTE

TREE PROTECTION SPECIFICATION

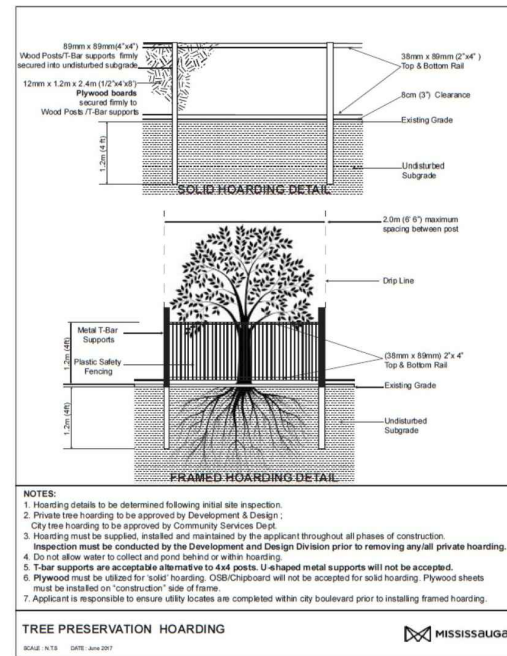

TREE INVENTORY

| TREE # | Species | Botanical Name | DBH (cm) | Direction | TPZ (m) | Condition Rating | Ownership Category | Comments |
|--------|---------------------|----------------------|----------------|-----------|---------|------------------|--------------------|---|
| 1 | Little-leaf Linden | Tilia cordata | 68 | Injury | 4.2 | Good | City | Multiple pruning wound with wound wood, good structure and good health |
| 2 | Siberian Elm | Ulmus pumila | 25, 29 | Injury | 3.6 | Good | City | Botanically and structurally in good condition, codominant stem with bark included |
| 3 | Black Locust | Robinia pseudoacacia | 44 | Retain | 3 | Fair | City | Tree with slight lean, fair health and structure |
| 4 | Black Locust | Robinia pseudoacacia | 37, 36, 43, 42 | Protect | 9.5 | Fair | City | Basal wound, leaning, codominant stems with bark included, basal suckering, fair health and structure |
| 5 | Red Cedar | Thuja plicata | 42 | Protect | 3 | Good | Private | Botanically and structurally in good condition |
| 6 | Sugar Maple | Acer saccharum | 22 | Retain | 2.4 | Good | Neighbour | Tree with good health and structural condition |
| 7 | Sugar Maple | Acer saccharum | 21 | Retain | 2.4 | Good | Neighbour | Tree with good health and structural condition |
| 8 | Norway Maple | Acer platanoides | 44 | Protect | 3 | Fair | Neighbour | Basal wound, dead branches (~5%), declining crown |
| 9 | Norway Maple | Acer platanoides | 50 | Injury | 3.6 | Good | Neighbour | Tree with good health and structural condition, one broken branch |
| 10 | Norway Maple | Acer platanoides | 42 | Protect | 3 | Fair | Neighbour | Vertical seams, wound wood, slight leaning, cavities |
| 11 | Eastern White Cedar | Thuja occidentalis | 29 | Remove | N/A | Fair | Private | Slightly leaning, fair health and structure |
| 12 | Norway Maple | Acer platanoides | 51 | Remove | N/A | Fair-Poor | Private | One large dead branch (~10cm diameter), fair health, fair structure (bent trunk), declining health |
| 13 | Eastern White Cedar | Thuja occidentalis | 24 | Remove | N/A | Fair | Private | Rubbing branches, fair health and structure |

Detailed Tree Inventory Table

- Tree to be removed/injured
- Tree to be preserved

Tree Protection Plan **TP1**

Note:
TO BE READ IN CONJUNCTION WITH REPORT PREPARED BY ARBORIST GROUP DATED: APRIL 07/22

Arborist Group. All rights reserved. These Drawings & Specs are confidential and shall remain the sole property of the Arborist Group. They shall not be reproduced (in whole or in part), shared with third parties or used in any manner on other projects or extensions to this project without the prior written consent of the company.

DRAWN BY: Serg Litvinov, ISA #ON-2281A

SCALE: 1: 300

| REVISION | NAME | DATE |
|----------|------|-------------|
| Rev3 | SL | April 07/22 |
| Rev2 | SL | March 29/22 |
| Rev1 | SL | March 24/22 |

ALL PREVIOUS ISSUES OF THIS DRAWING ARE SUPERSEDED